
# NEPS1000 Dry gas purging system



The **NEPS 1000 PUMPED** is the latest development for improving the effective and efficient use of dry purging gas for electronic, optical, high voltage, laser systems and equipment requiring gas drying.

High humidity and water vapour can have a deleterious impact on the use operation and long-term reliability of instruments and systems.

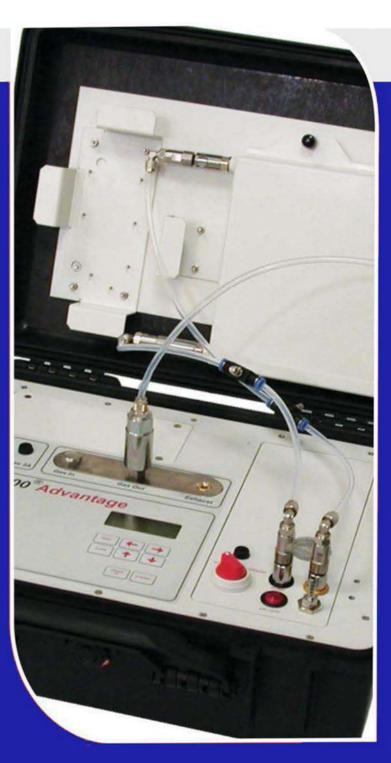

### **Contact Information**

Tel: +65 6610 7921 Fax: +65 6862 2520

Email: enquiry@streampeak.com.sg



### KEY FEATURE AND BENEFITS

- Fully Self Contained for Portable use
- Easy to Use Single Connection Purging
- Dewpoint and Pressure Readout
- Remote Dewpoint Sensing Option
- Portable and Robust
- User Programmable
- Automatic Purging Operation
- · Dewpointstat Gas Control
- Dewpoint Display from +20°C to -80°C
- · Maintainable Online
- NATO Approved

### MOISTURE PREVENTION TECHNOLOGY

#### THE COMPLETE PURGING SYSTEM

The NEPS1000 PUMPED is designed to maximise the dry gas purging process for humidity removal. A host of capabilities and functionality for effective and efficient control during the purging operation.

#### **EASY OPERATION**

NEPS1000 PUMPED is fully self-contained. Simply connect the equipment to be processed to the purge connection and the NEPS 1000 PUMPED is ready to operate.

#### **ECONOMIC GAS USE**

One of the NEPS 1000 PUMPED benefits is its use of the purge gas used for purging. By using a single pipe connection the purge gas is controlled and dispersed throughout the instrument or system being purged. During the depressurisation phase of purging the purge gas is isolated.

#### **USER-FRIENDLY**

The NEPS1000 PUMPED has easy to use selectable programming which can be set to view process control values and display dewpoint measurements in °C or °F with pressure in Kpa or psi. Highly visible liquid displays provide constant information and readouts during the operation and use of the NEPS1000 PUMPED.

#### **EQUIPMENT LEAK TESTING**

The NEPS1000 PUMPED comes with a selection of four in built leak testing capabilities to verify the sealing standard of the equipment to be purged. Pressure testing can be conducted at pressures from 10.3 Kpa (1.5 psi) to 34.4 Kpa (5.0 psi). Pressure leakrate display resolution is 0.01 psi.

#### **GAS QUALITY TESTING**

The dryness of the gas is important to the effectiveness of the purging operation and the NEPS1000 PUMPED dewpoint monitor can be used to check the dryness of the gas prior to commencing the purging operation.

#### UNIVERSAL VOLTAGE

The NEPS1000 PUMPED can be operated from global country voltages and frequencies ranging from 100 to 230 VAC at 50-60 Hz. There is also a 24VDC version available.

#### SINGLE-POINT PURGING

Traditional conditioning with dry nitrogen, gas or air depends on the flow of gas from an entry connection to an outlet port. In this mode, the gas will follow the simplest and easiest path to the outlet connection.

This can often lead to "pockets" of unconditioned gas.

Using the NEPS1000 PUMPED, the mode of operation changes to a more efficient single connection purging process, which also uses a choice of three selectable pressure cycles to ensure the dry gas influences all the space volume within an equipment.

During the purge process, the NEPS1000 PUMPED monitors the pressure. When the pre-selected setting is achieved the supply gas is isolated and an internal control valve allows the gas to flow to the exhaust port where the dewpoint of the mixed air/gas is measured. The purging process then continues until the desired dewpoint protection has been achieved.

# **STREAM PEAK** OFFERS A COMPREHENSIVE RANGE OF PURGING INSTRUMENTS FOR MOISTURE REMOVAL IN EQUIPMENTS AND SYSTEM TO PREVENT CONDENSATION AND HUMIDITY DAMAGE.

# NES1000 PUMPED APPLICATIONS

- · Optical Instruments
- LASER Systems
- SF6 Switch Gear
- · Printed Circuit Board Conditioning
- Double Glazing Cavities
- · Electronic Housings
- Workstations
- Storage Containers
- · Surveillance Instruments
- Underwater Equipment
- Thermal Imaging
- Image Intensifiers

## WHAT IS DEWPOINT?

The temperature to which air or gas must be cooled for the formation of condensation or frost.

This means dewpoint is ideal for stating the quality control requirement for purging an instrument or enclosure.

#### Why Purge?

Modern systems that use printed circuit boards, wires, electronic components, rubbers and plastics in their construction will have potentially significant amounts of moisture. The amount of in built moisture often described as "hygroscopic moisture" can be significant in comparison to the moisture (water vapour) contained within the air.




#### Why Choose NEPS 1000 PUMPED?


To maintain the flexibility and portability of NEPS1000 PUMPED three models are available fitted with a self contained pump and moisture adsorbing molecular sieves. All the operating functions of the Standard NEPS1000 Advantage are available with the pumped version and no additional gas supply is required.

The moisture adsorber can be readily exchanged when it is saturated and requires replacement. The NEPS1000 PUMPED contains one kilo of moisture adsorber, molecular sieves which are capable of adsorbing more than 20% of its own weight in moisture vapour before it is saturated. The NEPS1000 PUMPED is ideally suited if bottled dry gas is not available or cannot be handled or transported to the point of use.

# WHAT IS THE DEWPOINTSTAT FUNCTION

The Dewpointstat function of the NEPS1000 PUMPED is able to monitor and control the removal of in built hygroscopic moisture within a system or equipment.

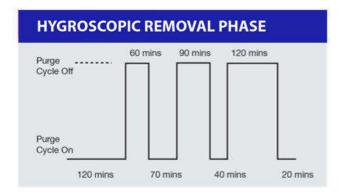

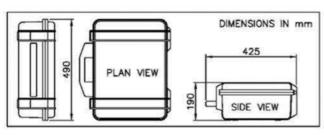

#### **NEPS1000 PUMPED Dewpointstat**

The Dewpointstat feature of the NEPS1000 PUMPED enables users to determine the amount of moisture contained within an equipment and to implement an optimised gas and purging procedure for production control.

Using the remote dewpoint sensor option, the NEPS1000 PUMPED monitors the progress of the dewpoint dryness within the equipment being purged and switches off and isolates the dry gas when the selected dewpoint is achieved. A data logger can be used to monitor the dewpoint degradation time, this allows the water vapour transmission rate (WVTR) to be calculated. The rate of water removal

(hygroscopic loading)
can also be determined during the initial purging phase.

scopic sight to a dewpoint the maintenance schedule.

NEPS1000 PUMPED used with to single point purge a telescopic sight to a dewpoint of -40°C as part of a routine maintenance schedule.

#### **TECHNICAL SPECIFICATIONS**

 Selectable Pressure Ranges
 10.3 Kpa (1.5 psi)
 Power
 230 volt 50 hz-60 hz

 17.2 Kpa (2.5 psi)
 100 volt 50 hz-60 hz

34.4 Kpa (5.0 psi) 24 volt DC 0 to 34.4 Kpa (0.5.0 psi) Power Consumption 3 amps

Display Range Pressure 0 to 34.4 Kpa (0-5.0 psi) Power Consumption 3 amps

Display Range Dewpoint (Selectable) Dimensions 490W x 4

(Selectable) Dimensions 490W x 425D x 190H (clospd) +20°C to -80°C dewpoint Weight 15 kilograms

+68°F to -94°F dewpoint Ingress Protection IP54 (Closed Case) Resolution 0.1°C dewpoint **Operating Temp** -10°C to +50°C Storage Temp -50°C to + 65°C Accuracy +/- 2°C dewpoint Flowrate (typical) 20 litres per minute Data Output Pressure 0 - 5 Volts See NEPS Accessories Optional extras Data Output Dewpoint 0 - 5 Volts

NSN: Order Code: NP 240 NP240 4440-99-912-6628 NP110

NP110 4440-99-812-6628 NP110 4440-99-404-2677 NP24 6625-99-821-5023

